


Fix for Jog wheel hardware bug.  
 The pullup via existing R5 needs a 47uF to gnd.  
 PNP and 10k are needed if you  
 want to programme the ESP

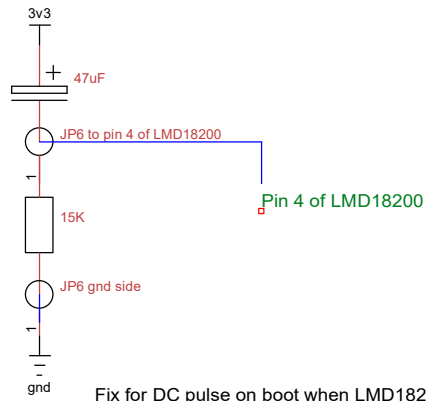

Fix for DC pulse on boot when LMD18200 on  
 board option used.  
 Remove JP6, replace with 15K.  
 Add 47uF from 3v3 rail.

Title DCC PCB rev1 errata fixes		
Author Computski		
File C:\Users\julia ... tCad1 DCC board errata.dsn	Document	
Revision 1.0	Date 2022-03-28	Sheets 1 of 1